高压限流熔新器的使用导则 Operation guide for H.V. Current-limiting fuse

2. Fuses used in single-phase system its rated voltage should be of 115% of max phase voltage.

熔新器额定电压的快报 Selection of reted voltage for fuse

熔断器的额定电压与电网电压相符 眼流熔崩器一般不宜降低电压使用,以避免熔断体截断电流时,产生的过电压超过电网允许的2.5

倍工作电压

voltage.

2.用子单相系统熔斯器、其都定电压按最高相电压的115%洗择: 3.用于三相中性占缔维系统或谐振绕地系统时、因系统可能发生所谓双捻地故障、即一个故障占在电源侧而另一个在负载制、日不简

1.一般用三相电路的熔斯器其额定电压按相应额定线电压选择:

- 相 此时熔断器的额定电压应接最高线电压选择
 - 4.用于三相中性点直接接地或经阴抗中性点接地系统时、按最高线电压选择
- Rated voltage of fuse should accord with mains voltage Generally current-limiting fuse cap't be used under declining voltage to avoid the circumstance of produced over voltage exceeding 2.5 times of electric network's allowed working voltage when Juse link cutting off the current. 1. Bated voltage of general fuses with three-phase circuit should be chosen according to the corresponding rated wire voltage.
- Elone fault point is at power side while the other at load side, and the phase is different. Now the rated voltage of fuse should be chosen, according o max wire voltage. 4. When used in three-phase neutral point direct earth or the earthed system by impedance neutral point, to choose according to max wire

When used in three-phase neutral point insulation system or resonance earthed system, as double earth fault may occur to the system.

熔断件额定电流的选择 Selection of rated current for fusing piece

- 1.熔新件熔新管的额定电流应大平或等平熔体的额定电流: 2.熔断件的额定电流应为负载长期工作电流 1.25 倍:
- 3.熔新器安装在三相封闭的柜体中,或单只装在绝缘浇注的筒内,或三根装在不封闭的柜体中时,皆要考虑适当降低容量使用。
- 1.Rated current of fusing piece and fusing tube should not less than the rated current of melt.
- Rated current of fusing piece should be 1.25 times of load long-term working current. Fuses are installed in the three-phase sealed cabinet or singly installed into the insulation poured canister, or three-phase in unsealed

熔质器开质电流的选择 Selection of breaking current for fuse 根据熔断器的保护作用,其最大开断电流不小于被保护电路的最大短路电流,最小熔化电流应不大于被保护电路的最小短路电流。

cabinet, proper capacity decline to use should be considered.

According to the protection function of fuse, its max breaking current should not less than max short circuit current of the circuit of protected electrical equipment min melting current should not more than the min short circuit current of protected circuit.

熔新器的保存和检查 Storage and inspection for fuse

- 1.熔断器应储存在干燥合适的场所
- 2.对摔落过的或受振动的熔断器在使用前应进行检验(直流电阻、零部件是否完好)。
- 3.故署久的嫁断器出厂/出库时应进行再次检查其申明值。
- 1. Fuses should be kept in dry and proper place.
- Check the have been fallen and vibrated fuses before using(whether DC resistance and components are in good condition). 3.Re-check its resistance value of fuses stored for a long time when leaving factory/sending out of warehouse.

1.安装熔斯器时,应紧固所有的零件,防止接触部分在正常运行时过热。

- 2.对三相安装的熔断件,即使一支动作,其他两支均应更换,因为其它两支虽未损坏,但已接近动作点,已到了易损坏的程度。
- 3.在更换动作过的熔新件时,应在动作10分钟后更换。如果在熔新件动作后发现管内有烟雾泄出或有噪声现象时,不应更换熔新件。
- 3.在更换动作过的溶断件时,应在动作10分钟后更换。如果在溶断件动作后及坑管内有烟雾湿出或有噪声境影时,不应更换溶断等需待熔断件与电源隔离后才允许更换。
- 4.对装在靠供电设备或带电导体附近时,应满足安全条例的规定。
 - 5.熔断器不能安装在有严重振动、灰尘、污染、潮湿的场所。
- 1. Tightly fix all components to avoid overheating for contact parts when installing fuses.
- 2.For fuses of three-phase installation, although one acts, another two all should be replaced. As the two though haven't been damaged, approach acting point and have reached the easy-damaging extent.
- 3. Replacement of an acted fusing piece should be done in 10 min after its action. If smoke leakage or noise occurs in the tube after fusing piece action, the fuse piece can be replaced only after it is out of the circuit.
- 4. More consideration should be taken when the fuse installed near power supply equipment or energized conductor.
 5. Fuses can't be installed in a place with severe vibration, dust, pollution and dampness.

熔断器的运输 Transportation for fuse

熔断器在运输途中,要严格防止振动、跌落、碰撞现象。对发生上述情况,要进行性能测试后再予使用。

Try to avoid vibration, falling, impact during the transportation for fuse. If the above conditions occur, do test thoroughly before it is used.

订货须知 Ordering notice

1.用户应提出熔断器的额定电压、额定电流、开断电流、保护对象等。

熔断器的安装及更换 Installation and replacement for fuse

- 2.用户需要样本上没有介绍的熔斯器时,请提出工作电压、工作电流、开新能力、外型尺寸等。我们可以按照您的要求设计产品。
- 1. User should point out the rated voltage, rated current, breaking current and protective object of fuse.
- 2. Please feel free to contact us for your special requirement beyond our catalogue.

用途 Applications

RW10-35型户外高压限流熔断器用于电压互感器的保护,电力线路的过载和短路保护。 RW10-35/0.5型 0.6-1.8A 范围内,1分钟熔断。2-7.5A1小时内熔断电流暂不规定。10A f,其电流为额定电流 2 倍时 1 小时内熔断。

 $RW10-35\ type\ outdoor\ H.V\ Current-limiting\ fuse\ is\ used\ for\ protecting\ for\ voltage\ transformer,\ protecting\ from\ overload\ and\ short\ circuit\ for\ power\ circuit.$

RW10-35/0.5 type melts in 1min within 0.6-1.8A. Within 2-7.5A for 1hour, the fusing current has not regulated temporarily. For 10A, while its current is 2 times of rated current, it melts in 1hour.


■型号含义 Model And Implication



■技术参数 Technical parameter

序号	产品型号 Product type	额定电压(KV) Rated voltage	额定电流(A) Rated current	三相断流容量 (MVA) Three-phase breaking capacity		重量 (kg)	备注
No.				cos Φ=0.07 ~ 0.15	CosΦ=0.6~0.8	Weight	Remark
G0142	RW10-35/0.5	35	0.5	1000	2000	19	保护电压互感器用 For protecting voltage transformer
G0143	RW10-35/2	35	2	200	600	19	保护电力线路用 For protecting power circuit
G0144	RW10-35/3	35	3	200	600	19	保护电力线路用 For protecting power circuit
G0145	RW10-35/5	35	5	200	600	19	保护电力线路用 For protecting power circuit
G0146	RW10-35/7.5	35	7.5	200	600	19	保护电力线路用 For protecting power circuit
G0147	RW10-35/10	35	10	200	600	19	保护电力线路用 For protecting power circuit
G0148	RW10-35/15	35	15	200	600	19	保护电力线路用 For protecting power circuit

■外形尺寸图 Outline dimensional drawing

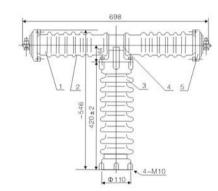

- 1、熔体管 Melt tube
- 2、瓷管 Porcelain tube
- 3、棒式支柱绝缘子 Bar type support insulator
- 4、紧固法兰 Clamping
- 5、接线端帽 Terminal end cap

图 Figure 4.1

■安装与使用 Installation and usage

- 1、熔断器安装时,应注意熔体管的额定电流必须与线路电流匹配。 2、熔断器熔断后,用户可以自行更换瓷套内的熔体管。
- 3、熔断器允许水平或垂直安装。
- 1. Rated current of melt tube should accord with circuit current when installing fuses.
- 2. Melt tube inside the porcelain sleeve can be replaced by user when fuse melts.
- 3. Level and vertical installation are allowed.